



## **AVIA PROPELLER Ltd.**

Beranových 666, 199 00 Praha - Letňany, Czech Republic

---

# **INFORMATION BULLETIN**

**No.:** V 506-5-I/64

**Concerns:** Demounting of cover front part for V 410, V 411 B and V 506 airscrew.

**Reason:** Damage of the root part of the airscrew blades during dismounting of the cover front part. Damage is caused by the crowbars which are used in case of more difficult dismounting.

**Recommended:**

In case of difficult dismounting of the front cover, try to loosen it by taps with the flat palm of the hand from the opposite sides. Use the crowbars only in an emergency and, if they are used, take care that their ends do not have sharp edges. During the breaking open procedure they should be leaned against the steel blade sleeve and not against the dural root. The root part of the blade is sufficiently stressed during operation and in the case of considerable damaging the airscrew blade must be exchanged for a new one.

Letňany March 25<sup>th</sup> 1964

Ing. Svoboda s. m.  
Manufacturer

Homola s. m.  
Supplier's Representative