



Subject :

Replacement of flange o-ring of V508 and V510 propeller type series

Discussion :

After propeller and engine overhaul procedures the dimensions of propeller and engine flange can be reduced. After propeller installation on engine with delivered standard flange o-ring P/N 000-6097 the oil leakage can occurs in propeller flange area.

Required action :

Contact propeller manufacturer to send an o-ring P/N 000-6119. This o-ring with bigger cross section area prevents oil leakage of the propeller installed on engine.

Effectivity :

This advisory applies to all propeller V508 and V510 type series installed on M601() Walter engines.

Caution :

This advisory is intended for overhauled propellers only. O-ring P/N 000-6119 must not be used as flange o-ring for new propellers !

Office of Airworthiness Zbyněk Tvrdek Date : July 26, 2006	Issue Michal Rout Date : July 26, 2006		Page : 1 Pages : 1
--	--	--	-----------------------